

Checking of the cylinder head assy. 2/3

MANDATORY

Symbols:

Please pay attention to the following symbols emphasizing particular information throughout this document.

▲ WARNING: Identifies an instruction, which if not followed, may cause serious injury or even death.

CAUTION: Denotes an instruction which if not followed, may severely damage the aircraft or

could lead to suspension of warranty.

♦ NOTE: Information useful to implement the change more easily.

1. General

<u>Issued by:</u> REMOS Aircraft GmbH Flugzeugbau Franzfelde 31 D-17309 Pasewalk

Web: www.remos.com - Telephone: +49-3973-225519-0

Release date: May 29th 2013

Date of effect: immediately

<u>Compliance:</u> before next take-off

Release Number: SA-006 engine cylinder head R2

SA-005 engine cylinder head / ROTAX ASB-912-062UL/ASB-912-062

Referenced Document: ROTAX Alert Service Bulletin ASB-912-062UL R2/ASB-912-062R2, latest issue

available via download on www.flyrotax.com

Models affected: G-3/600, GX

Affected S/N: Aircraft with engine serial numbers as per ROTAX ASB-912-062UL R2/

ASB-912-062R2 → ATTENTION – additional serial numbers!



Reason: As per ROTAX ASB-912-062UL R2/ASB-912-062R2: "Due to a deviation in the

manufacturing process some cylinder heads may have an oil leak in the intake channel in the area of the valve guide. There is a possibility of small machined through holes, which can increase the oil consumption which may result in an

engine stoppage."

Subject: • checking of the cylinder head assy. (2/3)

comply with ROTAX ASB-912-062UL R2/ASB-912-062R2

<u>Time required:</u> • check for applicability: 10 minutes

check spark plugs: 30 minutesreplacing cylinder head: 4 hours

2. Material Information

Tools needed: • as per ROTAX ASB-912-062UL R2/ASB-912-062R2

Parts needed: • as per ROTAX ASB-912-062UL R2/ASB-912-062R2

3. Compliance

Schedule for Inspection:
• before next flight

as per ROTAX ASB-912-062UL R2/ASB-912-062R2

<u>Level of maintenance:</u> • check for applicability: none

check spark plugs: line
 replacing cylinder head: heavy

replacing cylinder head: heavy

NOTE: If an inspection as per ASB-912-062UL R1/ASB-912-062R1 has already been

carried out, no further inspection is necessary.

▲ WARNING: As per ROTAX ASB-912-062UL R2/ASB-912-062R2: "Non-compliance with these

instructions could result in engine damages, personal injuries or even fatal injuries."



<u>License required:</u> (US-LSA)

check for applicability:

- owner/operator with Sport Pilot Licence (or higher)
- LSA Repairman, or
- A&P Mechanic, or
- Part 145 Repair Station

for spark plug checking:

- owner/operator with Sport Pilot Licence (or higher)
- LSA Repairman, or
- A&P Mechanic, or
- Part 145 Repair Station

for cylinder head replacement:

- LSA Repairman with ROTAX Heavy Maintenance Training, or
- A&P Mechanic with ROTAX Heavy Maintenance Training, or
- Part 145 Repair Station with ROTAX Authorization

<u>License required:</u> (EASA-LSA)

check for applicability:

- Owner/Operator
- REMOS Service Center

for spark plug checking:

- Owner/Operator
- REMOS Service Center

for cylinder head replacement:

- REMOS Service Center with ROTAX Heavy Maintenance Training, or
- Part 145 Repair Station with ROTAX and REMOS Authorization

4. CHECK for APPLICABILITY

Check Engine SN: The engine serial number is named on the aircraft equipment list and on the engine

data plate, which is found on the ignition cover, on the left, opposite the electric

starter. See ROTAX Maintenance Manual (Line) for further information.

<u>Documentation:</u> In case the engine is not affected by the ROTAX ASB-912-062UL R2/

ASB-912-062R2, sign off aircraft and engine logbook by a licensed person. Include

engine SN in the logbook entry.

In case the engine is affected, the ROTAX Alert Service Bulletin ASB-912-062UL R2/ASB-912-062R2 must be complied with to the full extent. Check off aircraft and

engine logbook by licensed person after inspection or repair is accomplished.



5. INSTRUCTIONS for INSPECTION

Instructions: Follow ROTAX ASB-912-062UL R2/ASB-912-062R2.

Documentation: In case no unusual deposits (excessive carbon or oil) are found on any of the two

spark plugs (top and bottom) of cylinders 2 and 3 each when being checked according to ROTAX ASB-912-062UL R2/ASB-912-062R2, restore the aircraft to original operating configuration according to ROTAX ASB-912-062UL R2/ASB-912-062R2 and REMOS Maintenance Handbook. Sign off aircraft and engine

logbook by a licensed person. Include engine SN in the logbook entry.

In case unusual deposits are detected, the ROTAX Alert Service Bulletin ASB-912-

062UL R2/ASB-912-062R2 must be complied with to the full extent.

6. INSTRUCTIONS for REPAIR

Instructions: Follow ROTAX ASB-912-062UL R2/ASB-912-062R2.

<u>Documentation:</u> In case excessive deposits (oil or carbon) are found on the spark plugs, the cylinder

head must be replaced in accordance with the relevant Maintenance Manual (Heavy). Make an entry in both the aircraft and engine logbook by a licensed

person. Do not operate the aircraft in this case.

Contact REMOS Aircraft and your nearest ROTAX aircraft engine distributor.

REMOS wishes you safe and fun flights! Always check your aircraft before you fly!



REMOS Aircraft GmbH Flugzeugbau

Franzfelde 31

17309 Pasewalk

GERMANY	Fax: +49-(0)3973-225519-99
Feedback Form for Safety Alert SA-006 engine cylind	der head
Das Flugzeug REMOS G3 / GX, Kennzeichen The aircraft REMOS G3 / GX, callsign	
mit der Seriennummer with serial number	
Motor-Seriennummer Engine serial number	
ist nicht betroffen von SA-006 is not affected by SA-006	
wurde gemäß SA-006 überprüft ohne Befund has been checked acc. to SA-006 without finding	
der Zylinderkopf wurde gemäß SA-006 ausgetauscht the cylinder head has been replaced acc. to SA-006	
Name des Halters / name of owner	
Adresse / adress	
Adresse / adress	
PLZ, Stadt / Zip Code, City	
Land / Country	Unterschrift / signature